

Murphy Aircraft mfg. Ltd.

Unit 1, 8155 Aitken Road,
Chilliwack, British Columbia, Canada
V2R 4H5

Tel: (604) 792-5855

Fax: (604) 792-7006

Safety Bulletin 080498E

Date: Wednesday, April 08, 1998
Chilliwack, British Columbia

Attention: Elite Trike Owners/Builders
Subject: NG-011 holes

Contact: **Technical Services**
 Murphy Aircraft Mfg. Ltd.
 Ph. 604-792-5855
 Fax. 604-792-7006
 e-mail murtech@murphyair.com

Information:

The part NG-011 has two 1/2" holes drilled in the base for installing it to the fuselage. These holes should be 5/16". A new part with the proper size holes will be sent to you shortly. The manual also tells you to drill 1/2" holes up through the part into the skins and carrythroughs (section 11 page 8). These holes **must be 5/16"** to suit the AN5-27A bolts.

[Home](#) | [Aircraft](#) | [Airshows](#) | [Our Story](#) | [Contact Us](#) | [Shipping](#) | [Technical Support](#)
[Education](#) | [Builder Directory](#) | [Builder Projects](#) | [Builder Completions](#) | [Links](#)

© Copyright 2004 Murphy Aircraft Mfg. Ltd.

